


- **1.0 Scope:** This manual contains supplemental information pertaining to the Molex 1.2mm Sealed product line, Molex series numbers 34899 and 34900
- **2.0 Product Description**: The Molex 1.2 sealed system is a series of connectors with 1x2, 1x3, 1x4 and 1x6 terminal configurations, designed to be used with the following Tyco 1.2 MCON terminals

1452665-3	MCON-1.2 LL (Locking- Lance) Receptacle terminal (wire size 0.25 - 0.35mm²)
1452668-3	MCON-1.2 LL (Locking- Lance) Receptacle terminal (wire size 0.50 - 0.75mm²)
7-1452671-1	MCON-1.2 LL (Locking-Lance) Receptacle terminal (wire size 1.0 - 1.5mm²)
2141114-3	MCON-1.2 CB (Clean- Body) Blade terminal (wire size 0.25 - 0.35mm²)
2141116-3	MCON-1.2 CB (Clean- Body) Blade terminal (wire size 0.50 - 0.75mm²)

Or the following Kostal MLK 1.2 terminals

32124734110	MLK-1.2mm Single wire seal LL (Locking- Lance) receptacle terminal (wire size 0.35mm²)
32124734120	MLK-1.2mm Single wire seal LL (Locking- Lance) receptacle terminal (wire size 0.5mm²)
32124734130	MLK-1.2mm Single wire seal LL (Locking- Lance) receptacle terminal (wire size 0.75 - 1.0mm²)

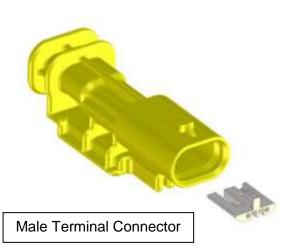



Female Terminal Connector

REVISION:	ECR/ECN INFORMATION:	TITLE:			SHEET No.
D3	EC No: UAU2016-0871	MXP120 Se	1 of 22		
	DATE: 2015/12/08		1 01 22		
DOCUMENT NUMBER:		CREATED / REVISED BY:	CHECKED BY:	APPRO\	/ED BY:
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Ko	oshy
TEMPLATE FILENAME: APPLICATION_SPEC[SIZE_A](V.1).DOC					



3.0 Reference Documents:

3.1 Molex Drawings

SD-34899-2001	1.2mm Sealed Inline 1 x 2, 1 x 3 Blade Assembly
SD-34899-6001	1.2mm Sealed Inline 1 x 4, 1 x 6 Blade Assembly
SD-34900-2001	1.2mm Sealed Inline 1 x 2, 1 x 3 Receptacle Assembly
SD-34900-6001	1.2mm Sealed Inline 1 x 4, 1 x 6 Receptacle Assembly
PS-34900-0001	1.2mm Sealed Inline Product Specification
PK-31301-898	1.2mm Sealed Inline Packaging Specification
SD-34996-1501	Cavity Plug Pin
SD-34996-1901	Cavity Plug Seal





3.2 Tyco Drawings

C-1452674	Rev. C2	Single wire sealed receptacle terminals (Locking Lance)
C-1418754	Rev. C6	Single wire sealed blade terminals (Locking Lance)
C-1718398	Rev. B4	Single wire sealed blade terminals (Clean Body)
967056GEN	Rev. B1	Rubber plug for cavity DIA 3.45

3.3 Kostal Drawings

DOC00079128 Rev. 03 Single Wire sealed receptacle terminals (Locking La	nce)
---	------

REVISION:	ECR/ECN INFORMATION:	TITLE:	SHEET No.		
D3	EC No: UAU2016-0871	MXP120 Se	2 of 22		
	DATE: 2015/12/08		2 Of 22		
DOCUMENT NUMBER:		CREATED / REVISED BY:	CHECKED BY:	APPRO\	/ED BY:
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Ko	shy
TEMPLATE FUENAME, APPLICATION SPECICIZE ANNAL DOC					


TEMPLATE FILENAME: APPLICATION_SPEC[SIZE_A](V.1).DOC



4.0 Procedure

- 4.1 General Requirements:
 - 4.1.01 Receptacle Terminals
 - 4.1.02 Blade Terminals
- 4.2 Assembly Instructions:
 - 4.2.01 Connector Assembly, as shipped:

Cutaway view of male connector shown for clarity

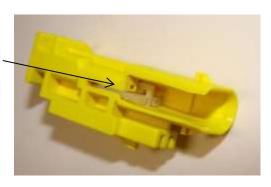



The PLR/ISL is shown in the as shipped position. The PLR/ISL should remain in the prelock position until all circuits are fully loaded. THE PLR/ISL SHOULD NEVER BE REMOVED

FROM THE ASSEMBLY!

4.2.02 ISL "slide to pre-lock"


If during shipping the connector ISL moves from its pre-lock position, it must be moved back to its pre-lock position. The ISL must be in pre-lock position to populate the connector. Slide a small (3.5mm maximum) slotted tip screwdriver under the edge of the ISL on one side. Using the blade of the screwdriver gently slide the ISL out. THE ISL

SHOULD NEVER BE FULLY REMOVED!


REVISION:	ECR/ECN INFORMATION:	TITLE:	SHEET No.		
D3	EC No: UAU2016-0871 DATE: 2015/12/08	MXP120 Se	3 of 22		
DOCUMENT	NUMBER:	CREATED / REVISED BY: CHECKED BY: APPROV			/ED BY:
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Ko	oshy
			ΤΕΜΡΙ ΔΤΕ ΕΙΙ ΕΝΙΔΙΜΕ	· APPLICATION SPEC	ISIZE AI(V 1) DOC





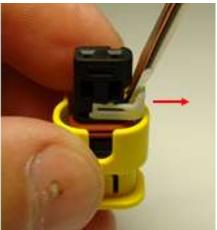

4.2.03 If during shipping the Connector PLR moves from its pre-lock position, it must be moved back to its pre-lock position. The PLR must be in pre-lock position to populate the connector. Using a set of serrated tip tweezers (refer to section 5.0 for details), grab the center rib feature of the PLR and lift the PLR to the pre-lock position. The PLR should never be fully removed!

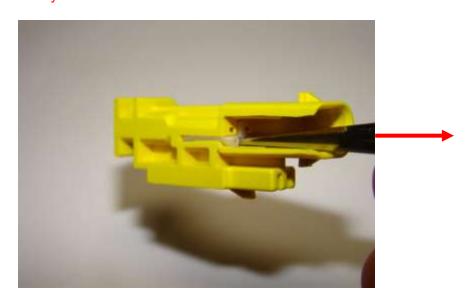


REVISION:	ECR/ECN INFORMATION:	IIILE:	IIILE:			
D3	EC No: UAU2016-0871	MXP120 Se	4 of 22			
	DATE: 2015/12/08		4 01 22			
DOCUMENT NUMBER:		CREATED / REVISED BY:	CHECKED BY:	APPRO\	/ED BY:	
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Ko	shy	
			TEMPLATE FILENAME	: APPLICATION SPEC	ISIZE AI(V.1).DOC	



4.2.04 Molex Cavity Plug Installation

4.2.04.1 A 2-piece assembly is available for plugging un-used circuits in the connector assembly. This assembly consists of a seal, part number 349961902 and a plastic pin, Part Number 349961501. The cavity plug should be installed prior to terminal insertion.

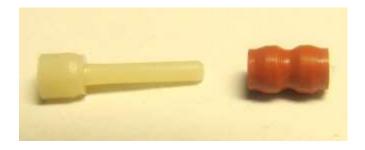

4.2.04.2 The seal is to be installed over the long, cylindrical portion of the pin and pressed on until it contacts the head of the pin





D3	EC No: UAU2016-0871 DATE: 2015/12/08	MXP120 Se	ealed Connection	System	5 of 22
DOCUMENT NUMBER:		CREATED / REVISED BY:	CHECKED BY:	APPRO\	/ED BY:
AS-34900-0001		J. Burgio	M. Vanslambrouck	uck V. Koshy	
	TEMPLATE FILENAME: APPLICATION SPECISIZE A](V. 1).DO:				



4.2.04.3 The cavity plug assembly can then be installed into the connector.

NOTE: Care should be taken while installing the cavity plug assembly so that the seal is not pinched.







Insert the plug assembly into the circuit you wish to plug and carefully press
 the cavity plug in until the head of the pin is flush with the surface of the
 connector

A pinched seal may increase the force required to completely seat the cavity plug.



REVISION:	ECR/ECN INFORMATION:	TITLE:	SHEET No.		
D3	EC No: UAU2016-0871	MXP120 Se	6 of 22		
	DATE: 2015/12/08		0 01 22		
DOCUMEN ³	DOCUMENT NUMBER: CREATED / REVISED BY:		CHECKED BY:	<u>APPRO\</u>	/ED BY:
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Ko	shy
TEMPLATE FUENAME, APPLICATION, SPECIFIE AVVAIDOS					



4.2.05 TE Cavity Plug #967056-1


4.2.05.1 Installation per TE Application Specification 114-18025



4.2.06 Terminal Installation – Blade and receptacle

4.2.06.1 With ISL/PLR in pre-lock position, orient terminal to rear of connector. Grip the wire no less than 1.25 inches from the terminal insulation crimp and insert through appropriate circuit opening. If resistance is encountered, retract the terminal and adjust the angle of insertion. Continue inserting the terminal until it stops and locks up on the lock finger.

Cable seal terminal orientation feature (proper orientation)

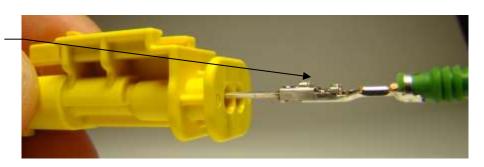





REVISION:	ECR/ECN INFORMATION:	TITLE:			SHEET No.
D3	EC No: UAU2016-0871	MXP120 Se	7 of 22		
	DATE: 2015/12/08				
DOCUMENT	ΓNUMBER:	CREATED / REVISED BY: CHECKED BY: APPROV		/ED BY:	
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Ko	oshy
			ΤΕΜΡΙ ΔΤΕ ΕΙΙ ΕΝΔΜΕ	· APPLICATION SPEC	ISIZE AI(V 1) DOC



After installing the terminals, use a small (3.5mm maximum) slotted tip screwdriver to seat the PLR. Care should be taken to prevent damaging the terminal blades.

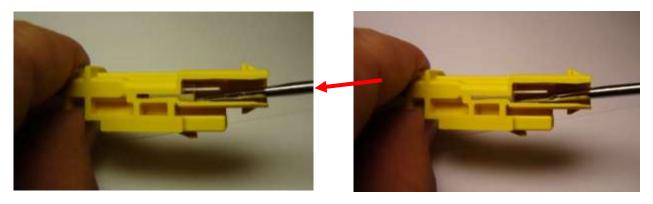

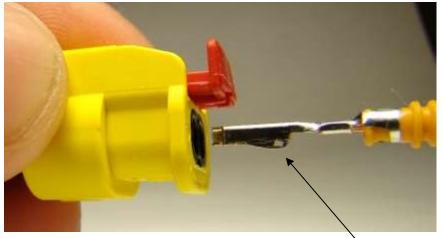




Cable seal terminal orientation feature (proper orientation)

TEMPLATE FILENAME: APPLICATION_SPEC[SIZE_A](V.1).DOC

REVISION:	ECR/ECN INFORMATION:	TITLE:			SHEET No.	
D3	EC No: UAU2016-0871 DATE: 2015/12/08	MXP120 Sealed Connection System 8 of 22				
DOCUMEN ^T	ΓNUMBER:	CREATED / REVISED BY:	CHECKED BY:	<u>APPRO\</u>	<u>ED BY:</u>	
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Ko	shy	



After Installing the terminals, push the ISL into the lock position. If the ISL is difficult to seat, verify that all terminals are seated properly.

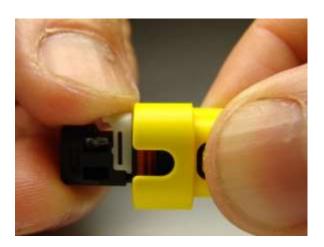


4.2.07 Harness taping recommendation

There should be a minimum of 15mm between the back of the connector and the tape used on the wire harness.

SHEET No.

The PLR/ISL must be closed prior to the taping operation.

The tape must not contact the connector housing.

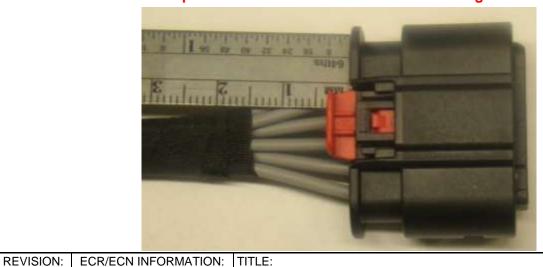


D3	EC No: UAU2016-0871 DATE: 2015/12/08	MXP120 Sealed Connection System		9 of 22	
DOCUMEN ⁻	T NUMBER:	CREATED / REVISED BY:	CHECKED BY:	<u>APPRO\</u>	<u>/ED BY:</u>
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Koshy	
TEMPLATE FILENAME: APPLICATION SPECISIZE AVV.11.DOC					




4.3 Connector Mating

4.3.01 Begin mating procedure by sliding the connector and header together, press firmly until the connectors are fully mated and locked



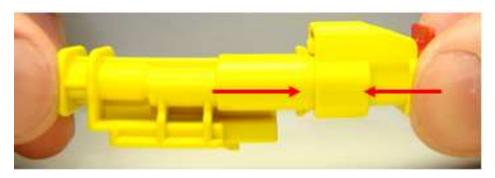

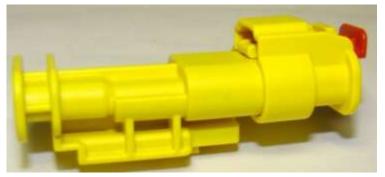


D3	EC No: UAU2016-0871 DATE: 2015/12/08	MXP120 Se	ealed Connection	System	10 of 22
DOCUMEN	T NUMBER:	CREATED / REVISED BY:	CHECKED BY:	APPRO\	/ED BY:
AS	S-34900-0001			V. Ko	oshy
	TEMPLATE FILENAME: APPLICATION SPECISIZE AI(V.1).DOC				




4.3.02 Once the connector halves are mated, seat the CPA by pressing in the center of the CPA until positive engagement is felt



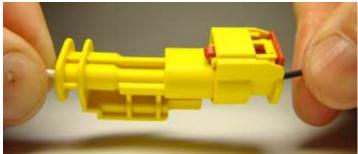

4.4 Connector Un-mating


4.4.01 Disengage the CPA by pulling back as shown

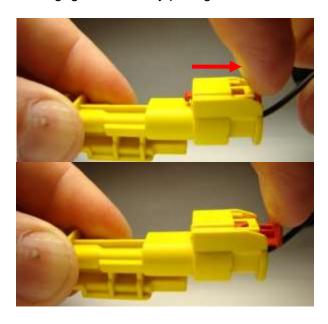


D3	EC No: UAU2016-0871	MYP120 Sa	MXP120 Sealed Connection System			
DS	DATE: 2015/12/08	IVIAT 120 Se	11 of 22			
DOCUMEN.	T NUMBER:	CREATED / REVISED BY:	CHECKED BY:	APPRO\	/ED BY:	
AS	S-34900-0001	J. Burgio	M. Vanslambrouck	V. Ko	oshy	
			TEMPLATE FILENAME	: APPLICATION SPEC	SISIZE AI(V.1).DOC	



4.4.02 Push the connector halves together to unload the pressure on the latch system

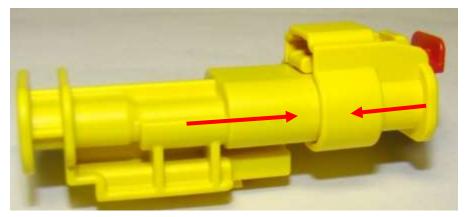

4.4.03 Depress the latch with your thumb and hold it down while gently pulling the connector

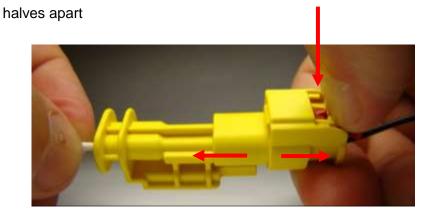

D3	EC No: UAU2016-0871 DATE: 2015/12/08	MXP120 Se	aled Connection	System	12 of 22	
DOCUMENT	ΓNUMBER:	CREATED / REVISED BY:	CHECKED BY:	APPRO\	/ED BY:	
AS	5-34900-0001	J. Burgio M. Vanslambrouck V. Ko		shy		
TEMPLATE FILENAME: APPLICATION SPEC[SIZE A](V.1).DOC						




4.5 Terminal servicing

4.5.01 Male Connector

4.5.01.1 Lift the PLR to the pre-lock position using a set of serrated tip tweezers (refer to section 5.0 for details); grab the center rib feature of the PLR and lift the PLR to the pre-lock position.

THE PLR SHOULD NEVER BE FULLY REMOVED!


Use serrated, medium tweezers to lift PLR to pre-lock position. Grab the center rib feature of the of PLR

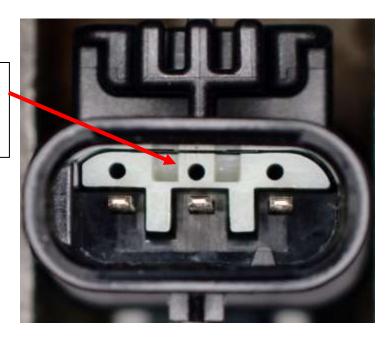


Magnified view (male connector)

D3	ECR/ECN INFORMATION: EC No: UAU2016-0871 DATE: 2015/12/08	MXP120 Se	aled Connection	System	13 of 22
DOCUMENT NUMBER: AS-34900-0001		CREATED / REVISED BY: J. Burgio	CHECKED BY: M. Vanslambrouck	APPRO\	
	1-34300-0001	U. Bargio	TEMPLATE SU ENAME		



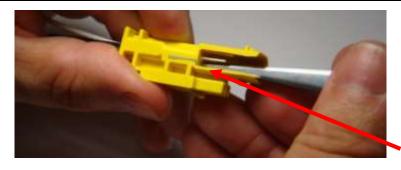

PLR in locked position

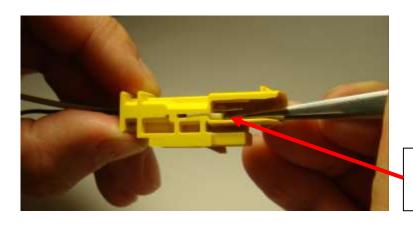


PLR in unlocked position

4.5.01.2 Disengage the terminal lock finger by inserting the service tool (Molex #63824-2900) through the service hole in the PLR. Push straight down gently and apply pressure to release the lock finger/ This motion will release the lock finger, "picking" is not required

REVISION:	ECR/ECN INFORMATION:	TITLE:	TITLE:		SHEET No.
D3	EC No: UAU2016-0871	MXP120 Se	14 of 22		
	DATE: 2015/12/08		14 01 22		
DOCUMENT	NUMBER:	CREATED / REVISED BY:	CHECKED BY:	APPRO\	/ED BY:
AS-34900-0001		J. Burgio	M. Vanslambrouck V. Koshy		oshy
			ΤΕΜΡΙ ΔΤΕ ΕΙΙ ΕΝΙΔΙΜΕ	· APPLICATION SPEC	ISIZE AI(V 1) DOC



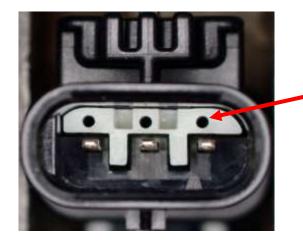

Holes to insert service tool to disengage terminal

TEMPLATE FILENAME: APPLICATION_SPEC[SIZE_A](V.1).DOC



4.5.01.3 While holding pressure on the lock finger with the service tool, gently pull on the wire to remove the terminal




REVISION:	ECR/ECN INFORMATION:	TITLE:			SHEET No.
D3	EC No: UAU2016-0871 DATE: 2015/12/08	MXP120 Se	15 of 22		
DOCUMEN'	T NUMBER:	CREATED / REVISED BY:	CHECKED BY:	APPRO\	<u>/ED BY:</u>
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Ko	shy




4.5.02 Female connector

4.5.02.1 Slide a small (3.5mm maximum) slotted tip screwdriver under the edge of the ISL on one side. Using the blade of the screwdriver gently slide the ISL out.

THE ISL SHOULD NEVER BE FULLY REMOVED!

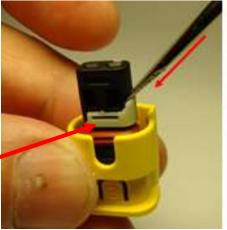

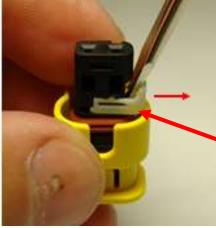

ISL in unlocked position


Do not insert the service tool in to the receptacle terminal; damage to the contact beam will

occur

ISL in

locked

position

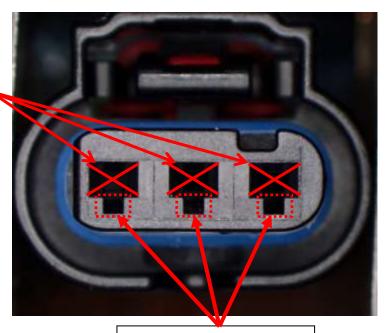


Magnified view showing Service hole to insert tool to disengage the terminal

REVISION:	ECR/ECN INFORMATION:	TITLE:			SHEET No.
D3	EC No: UAU2016-0871 DATE: 2015/12/08	MXP120 Se	16 of 22		
DOCUMEN ^T	ΓNUMBER:	CREATED / REVISED BY:	CHECKED BY:	<u>APPRO\</u>	/ED BY:
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Ko	shy


TEMPLATE FILENAME: APPLICATION_SPEC[SIZE_A](V.1).DOC



4.5.02.2 Disengage the terminal by inserting the service tool (Molex #63824-2900) through the service hole in the PLR. Push straight down gently and apply pressure to release the terminal, "picking" is not required

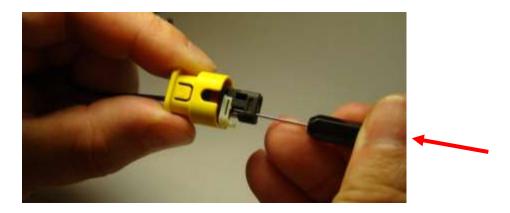

4.5.02.3 While holding pressure on the terminal release feature with the service tool, gently pull on the wire to remove the terminal.

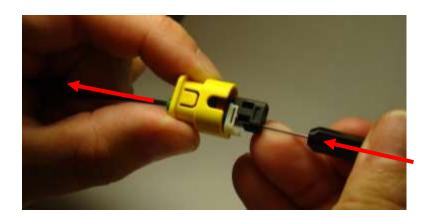

D3	EC No: UAU2016-0871 DATE: 2015/12/08	MXP120 Se	aled Connection	System	17 of 22
DOCUMEN	NUMBER:	CREATED / REVISED BY:	CHECKED BY:	APPRO\	/ED BY:
AS	3-34900-0001	J. Burgio M. Vanslambrouck V. Kosh		oshy	
	TEMPLATE FILENAME: APPLICATION SPECISIZE AIV 1) DOC				

DEVICION. FOR/ECN INFORMATION. TITLE.



4.6 Electrical Continuity Checking

4.6.01 Male Connector


4.6.01.1 Recommended Pogo Pin

Lone Star Industrial part number LS054RS-318 with the standard spring

force (3.7oz) option (or equivalent).


www.lonestarindustrial.com


4.6.01.2 Pogo Pin Contact Point

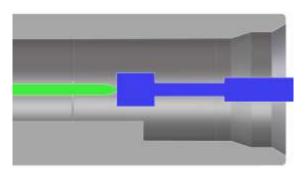

The pogo pin is positioned to contact the tip of the blade terminal.

4.6.01.3 Pogo Pin Patterns

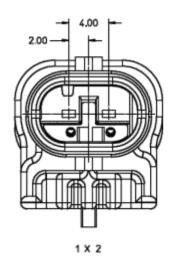


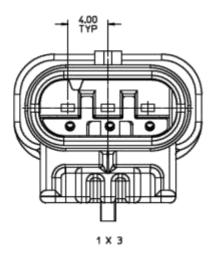


REVISION:	ECR/ECN INFORMATION:	TITLE:			SHEET No.
D3	EC No: UAU2016-0871 DATE: 2015/12/08	MXP120 Se	18 of 22		
<u>DOCUMEN</u>	ΓNUMBER:	CREATED / REVISED BY: CHECKED BY: APPROV		<u>/ED BY:</u>	
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Ko	shy

TEMPLATE FILENAME: APPLICATION_SPEC[SIZE_A](V.1).DOC



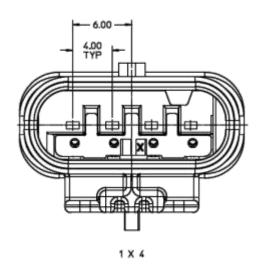

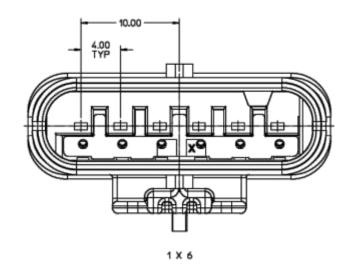


4.6.02 Female Connector

4.6.02.1 Recommended Pogo Pin


Lone Star Industrial part number LS054RS-312 with the standard spring force (3.7oz) option (or equivalent).

www.lonestarindustrial.com

4.6.02.2 Pogo Pin Contact Point

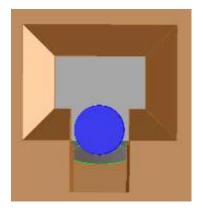


The pogo pin is positioned to contact the visible edge of the terminal box located within the terminal service hole

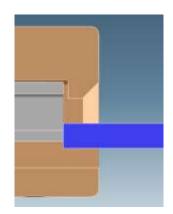

REVISION:	ECR/ECN INFORMATION:	TITLE:			SHEET No.
D3	EC No: UAU2016-0871	MXP120 Sealed Connection System			19 of 22
	DATE: 2015/12/08		19 of 22		
DOCUMENT	NUMBER:	CREATED / REVISED BY:	CHECKED BY:	APPRO\	/ED BY:
AS-34900-0001		J. Burgio	M. Vanslambrouck V. Koshy		shy
TEMPLATE FILENAME: APPLICATION_SPEC[SIZE_A](V.1).DOC					



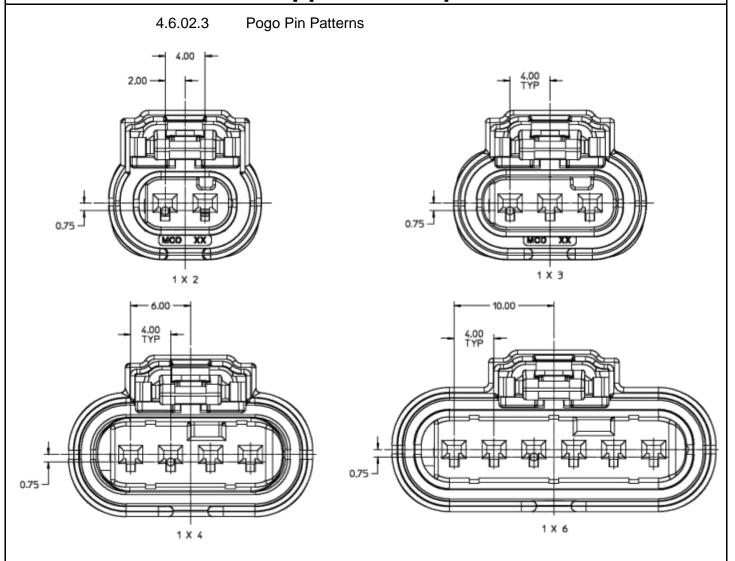

TEMPLATE FILENAME: APPLICATION_SPEC[SIZE_A](V.1).DOC				[SIZE_A](V.1).DOC	
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Koshy	
DOCUMENT NUMBER:		CREATED / REVISED BY:	CHECKED BY:	APPROVED BY:	
	DATE: 2015/12/08				20 of 22
D3	EC No: UAU2016-0871	MXP120 Se	MXP120 Sealed Connection System		
REVISION:	ECR/ECN INFORMATION:	TITLE:			SHEET No.



5.0 Service tool information

- 5.1 Slotted tip screwdriver with a maximum tip width of 3.5 mm
- 5.2 Straight tip, serrated, medium point tweezers
 - 5.2.01 Reference: http://www.excelta.com/product_categories/general-purpose-

tweezers/products/straight-tip-medium-point-tweezer





5.3 Terminal service tool: Molex Part Number 638242900



5.4 Alternative Terminal Service tool: GM #J-38125-22



TEMPLATE FILENAME: APPLICATION_SPEC[SIZE_A](V.1).DOC					
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Koshy	
DOCUMENT NUMBER:		CREATED / REVISED BY:	CHECKED BY:	APPROVED BY:	
	DATE: 2015/12/08	MXP120 Sealed Connection System			210122
D3	EC No: UAU2016-0871				21 of 22
REVISION:	ECR/ECN INFORMATION:	TITLE:			SHEET No.



6.0 Revision Information

Revision	Date	Description
1	8/1/2012	Initial draft
А	1/30/2014	Updated with 1x3, 1x4 CKT sizes and added Kostal terminal part#
В	6/27/2014	Removed Tyco 'Locking Lance' blade terminals, Added photos of service tools
С	1/21/2015	Removed USCAR interface drawing information; Added cavity plug installation procedure. Added GM service and probe tool information.
D	3/16/2015	Added fixture probing information. Removed GM probing tool information.
D1	4/27/2015	Added taping recommendation
D3	12/08/2015	LL terminal added for 1.0 – 1.5mm² wire size. Addition of TE Cavity Plug #967056-1.

REVISION:	ECR/ECN INFORMATION:	TITLE:			SHEET No.
D3	EC No: UAU2016-0871	MXP120 Sealed Connection System			22 of 22
	DATE: 2015/12/08				22 Of 22
DOCUMENT NUMBER:		CREATED / REVISED BY:	CHECKED BY:	APPROVED BY:	
AS-34900-0001		J. Burgio	M. Vanslambrouck	V. Koshy	
TEMPI ATE FILENAME: APPLICATION SPECISIZE AVAILABLE					